

3.5 x 3.5mm Metal Sealed SMD Hemispherical Lens Type

Typical Optical-Electrical Characteristics


| | (I _F =350mA, T _a =25°C) | | | | |
|----------------------------|---|------|-----|-----|-----|
| Item | Symbol | Unit | Min | Тур | Max |
| Peak Wavelength(*) | λ_{p} | nm | 335 | 340 | 345 |
| Radiant Flux(**) | Po | mW | 65 | 85 | - |
| Full Width at Half Maximum | ⊿λ | nm | - | 10 | - |
| Forward voltage | V _F | ٧ | 3.8 | - | 5.5 |
| Viewing Half Angle | 2θ _{1/2} | deg. | - | 70 | - |

^(*)Peak Wavelength Measurement tolerance is ±3nm.

Specification and dimension are subject to change for improvement without notice.

Mechanical Specifications and Exterior photo

(Unit: mm)

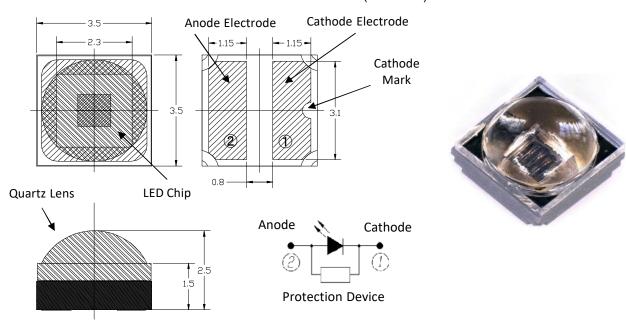

^(**)Radiant Flux Measurement tolerance is $\pm 10\%$.



3.5 x 3.5mm Metal Sealed SMD Hemispherical Lens Type


Absolute Maximum Ratings

| Item | Symbol | Unit | Value |
|-----------------------|------------------|------------|----------------------------------|
| Forward Current | I_{F} | mA | 600 |
| Reverse Voltage | V_R | V | 5 |
| Junction Temperature | $T_{\mathtt{J}}$ | $^{\circ}$ | 90 |
| Operating Temperature | T _{OPR} | $^{\circ}$ | -30 ∼ +85 |
| Storage Temperature | T_{STR} | $^{\circ}$ | -40 \sim +85 (No condensation) |


Derating Curve

800 700 (30,600) 600 Forward Current: IF (mA) 500 400 300 (85,100) 200 100 0 0 20 40 60 80 100 Ambient Temperature: Ta (deg)

Recommended solder pad

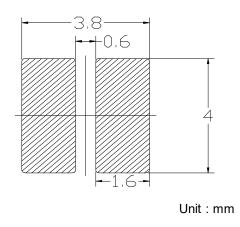


Reflow soldering profile

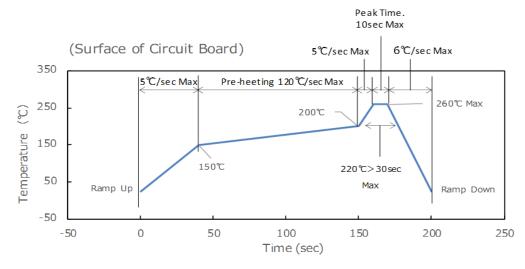




3.5 x 3.5mm Metal Sealed SMD Hemispherical Lens Type


Forward Voltage vs Forward Current

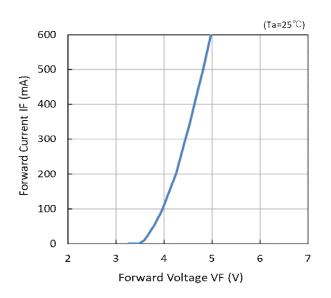

Forward Current vs Radiant Flux

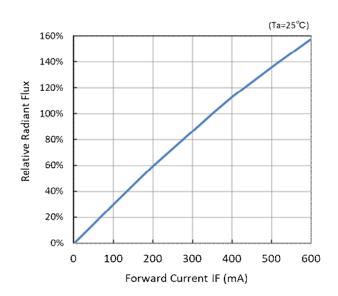

Spectrum

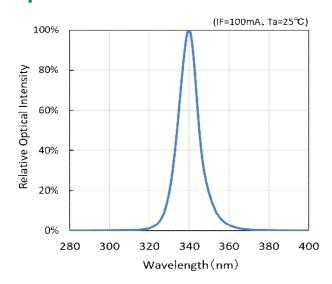


• These data as on the page 3 were determined with Al-substrate on a heat sink and fan.



3.5 x 3.5mm Metal Sealed SMD Hemispherical Lens Type

Radiation Pattern

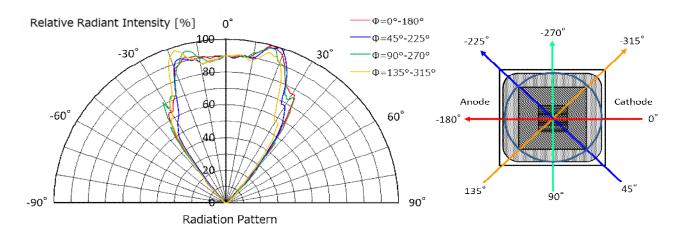

Handling Static Electricity

This product is sensitive to static electricity and surge voltages, which may damage the device and reduce reliability. When handling the product, please refer to the example below and take sufficient measures against static electricity.

- Charge removal using wrist straps, conductive clothing, conductive shoes, conductive flooring, etc.
- Eliminating electric charges by installing equipment, jigs, etc. in the work area.
- · Installation of workbenches, storage shelves, etc. using conductive materials.

WARNING



- · LEDs emit very strong UV radiation.
- \cdot Do not look at the LED light with the naked eye or irradiate the skin.
- · UV radiation can harm your eyes and skin.
- To prevent UV radiation exposure, wear protective eyewear and protective equipment.
- · If LEDs are embedded in devices, please indicate warning labels against the UV light LED used.
- · Keep out of reach of children.